



Access Recreation Group, LLC
 Cindy Burkhour, MA, CTRS, CPRP
 2454 Lamplighter Drive, Jenison, MI 49428-9127
 Mobile (616)560-2378
AccessRecreationGroup@juno.com

Bay View Farm Trail Accessibility Information






Trail Head Location: Thoreson Road near M22







Date Assessed: 10/24/18



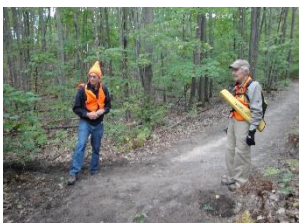

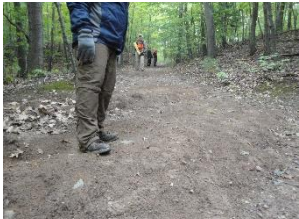

Accessibility Information:






Total Trail Length: 2.4 miles/elevation change 122'	Overall Barrier Descriptions
Surface: packed earth, some segments enhanced with crush/fines	Grass, mowed meadow, some loose sand segments
Tread Width: Typical = greater than 36" Minimum = less than 9"	Some segments have washout erosion with single track rutting & encroaching vegetation
Running Slope: Typical = under 10% Maximum = up to 25%	20% of the trail has running slopes under 5%; 47% of the trail has running slopes between 5% & 12.5%; 33% of the trail has slopes greater than 12.5%
Cross Slope: Typical = less than 3% Maximum = up to 29.9%	Up to 29.9% cross slope in straight up/down hill segments with significant soil erosion




** Slopes between 5% & 8.33% are equal to the slope on a ramp in the built environment

Feature Barrier Hill Top Hill Bottom	Elevation	Distance	Average Running Slope %	Photo #	Barrier Description: (slope, cross slope, width, surface, head clearance, reach range, clear space, maneuvering/passing space, operation)
Feature Barrier	649'	8'		1 	Information Kiosk & Map Box: no accessible route from parking to trailhead information kiosk, 3" wood barrier & inaccessible grass surface
Feature Barrier	644'	55'		2 	Parking: Open gravel parking lot (large crush +1") No accessible parking spaces
Feature					Toilets: None
Feature					Potable Water: None
Barrier	656'	304'	4%	3 	Surface: packed earth with some crush/fines Slopes: 10% - 15% at road intersection Width: + 36"
Barrier	658'	41'	5%	4 	Surface: soft sand Slope: 18% Width: reduced to 12" due to rutting from erosion/run off
Barrier	665'	80'	9%	5 	Surface: earthen water bar across trail 4" high creating a trail tread obstacle Slope: under 5% Width: +36"
Barrier	679'	659'	2%		Surface: packed earth; across trail roots Short steep slope segments: up to 8% Surface: earthen water bar across trail 4" high creating a trail tread obstacle Width: +36"

Feature Barrier Hill Top Hill Bottom	Elevation	Distance	Average Running Slope %	Photo #	Barrier Description: (slope, cross slope, width, surface, head clearance, reach range, clear space, maneuvering/passing space, operation)
Barrier	687'	104'	8%	<p>6</p>  <p>7</p> 	<p>Surface: packed earth Slope: cross slope 11.6%; Short steep slope segments: up to 9.5% Surface: earthen water bar across trail 4" high creating a trail tread obstacle Width: +36"</p>
Barrier	695'	159'	5%		<p>Surface: packed earth Short steep slope segments: up to 9% Surface: earthen water bar across trail 4" high creating a trail tread obstacle Width: +36"</p>
Barrier	708'	211'	6%	<p>8</p> 	<p>Surface: group of 6 earthen water bar across trail 4" high creating a trail tread obstacle Short steep slope segments: up to 12.6% Width: +36"</p>
Barrier	730'	159'	14%	<p>9</p> 	<p>Surface: packed earth; some rocks and roots Surface: earthen water bar across trail 4" high creating a trail tread obstacle Short steep slope segments: up to 18.5%; 16.6% Width: +36"</p>
Barrier	745'	106'	14%	<p>10</p> 	<p>Surface: packed earth; some roots Short steep slope segments: up to 15% Width: +36"</p>
Barrier	734'	106'	10%	<p>11</p> 	<p>Surface: packed earth Surface: earthen water bar across trail 4" high creating a trail tread obstacle Surface: triple earthen water bars across trail 4" high creating a trail tread obstacle Short steep slope segments: up to 11.6% Width: +36"</p>

Feature Barrier Hill Top Hill Bottom	Elevation	Distance	Average Running Slope %	Photo #	Barrier Description: (slope, cross slope, width, surface, head clearance, reach range, clear space, maneuvering/passing space, operation)
Barrier	729'	106'	5%	12 	Surface: surface washout; large roots Slope: under 5% Width: +36"
Barrier	764'	476'	7%	13  14 	Surface: some loose sand Surface: packed earth Slope: cross slope 10.9% Short steep slope segments: up to 25% Width: narrowed to 9" due to encroaching vegetation and washout/erosion;
Barrier	771'	53'	13%	15 	Surface: large across trail tread roots +3", +4" Short steep slope segments: up to 9.3%, 14%, 13.3%; cross slope 20.2% (midway) Width: +36"
Barrier	745' 729'	211' 265'	12% 6%	16  17 	Ski post Surface: in inaccessible grass surface Slope: cross slope Short steep slope segments: up to 12% Width: +36"

Feature Barrier Hill Top Hill Bottom	Elevation	Distance	Average Running Slope %	Photo #	Barrier Description: (slope, cross slope, width, surface, head clearance, reach range, clear space, maneuvering/passing space, operation)
Barrier	725'	159'	2%	18 	Surface: packed earth with some loose sand Short steep slope segments: up to 14.4%, 14.1% Width: +36"
Barrier	714' 670'	528' 415'	2% 11%	19 	Surface: packed earth with some loose sand Short steep slope segments: up to 8.9%, 14.6%, 4.6%, 8% Width: +36"
Barrier	662'	216'	4%	20 	Surface: inaccessible grass surface Short steep slope segments: up to 13.2%; ↑slope 17.1%; ditch Width: +36"
Barrier	666' 661'	211' 53'	2% 9%	21 	Surface: grass with cross trail roots Short steep slope segments: up to 10.5% w/cross slope 18.4%; 8% w/cross slope 10.2%; 17.5% w/across trail roots; 17.3% Width: +36"
Barrier	642' 658' 619' 609' 646' 626'	370' 528' 580' 476' 264' 211'	5% 3% 7% 2% 14% 9%		Surface: crowning & ruts (@6000'); grass w/ruts & washouts Short steep slope segments: up to 10.5%, 11.6%,13.2%, 14.8%, 13.3%, 19.3%, 16.9%, 14.6; cross slopes 16.2%, 26.8%, 20%, 18%, 28.9% Width: +36"
Barrier	598' 609' 638' 606'	528' 686' 1320' 1162'	5% 2% 2% 3%	23 	Surface: crush/fines Slope: under 5% Width: + 10'

Feature Barrier Hill Top Hill Bottom	Elevation	Distance	Average Running Slope %	Photo #	Barrier Description: (slope, cross slope, width, surface, head clearance, reach range, clear space, maneuvering/passing space, operation)
Barrier	600' 605' 605'	633' 423' 317'	1% 1% >1%	<p>24</p>  <p>25</p> 	<p>Surface: crush/fines Slope: under 10% (allowed by ASHTO) Width: + 10'</p>
	615'	106'	9%	<p>26</p> 	<p>Surface: crush/fines Slope: under 5% Width: + 10'</p>
	624'	740'	1%		<p>Surface: crush/fines Slope: under 5% Width: + 10'</p>